




**MONTERINGSANVISNING · INSTALLATION INSTRUCTIONS  
MONTAGEANLEITUNG · INSTRUCTIONS DE MONTAGE**

## Saab 9-5 5D


Cargo net

Accessories Part No.	Group	Date	Instruction Part No.	Replaces
400 111 795 400 130 415	9:88-08	Mar 01	51 34 069	51 34 069 Jun 98

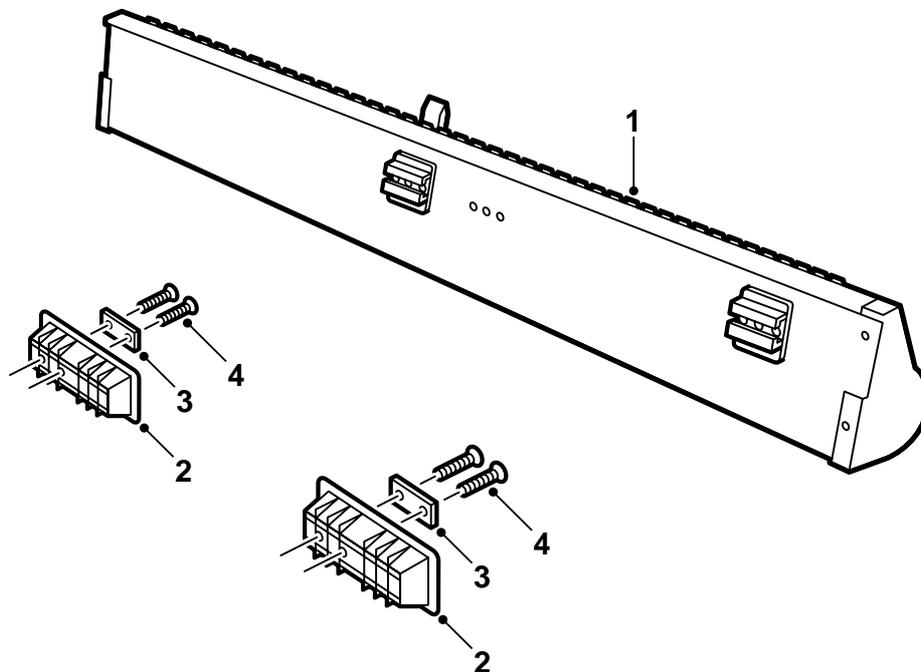

E980A104

- 1 Cassette with net
- 2 Slide rail (x2)
- 3 Plastic fitting (x2)
- 4 Screw (x4)

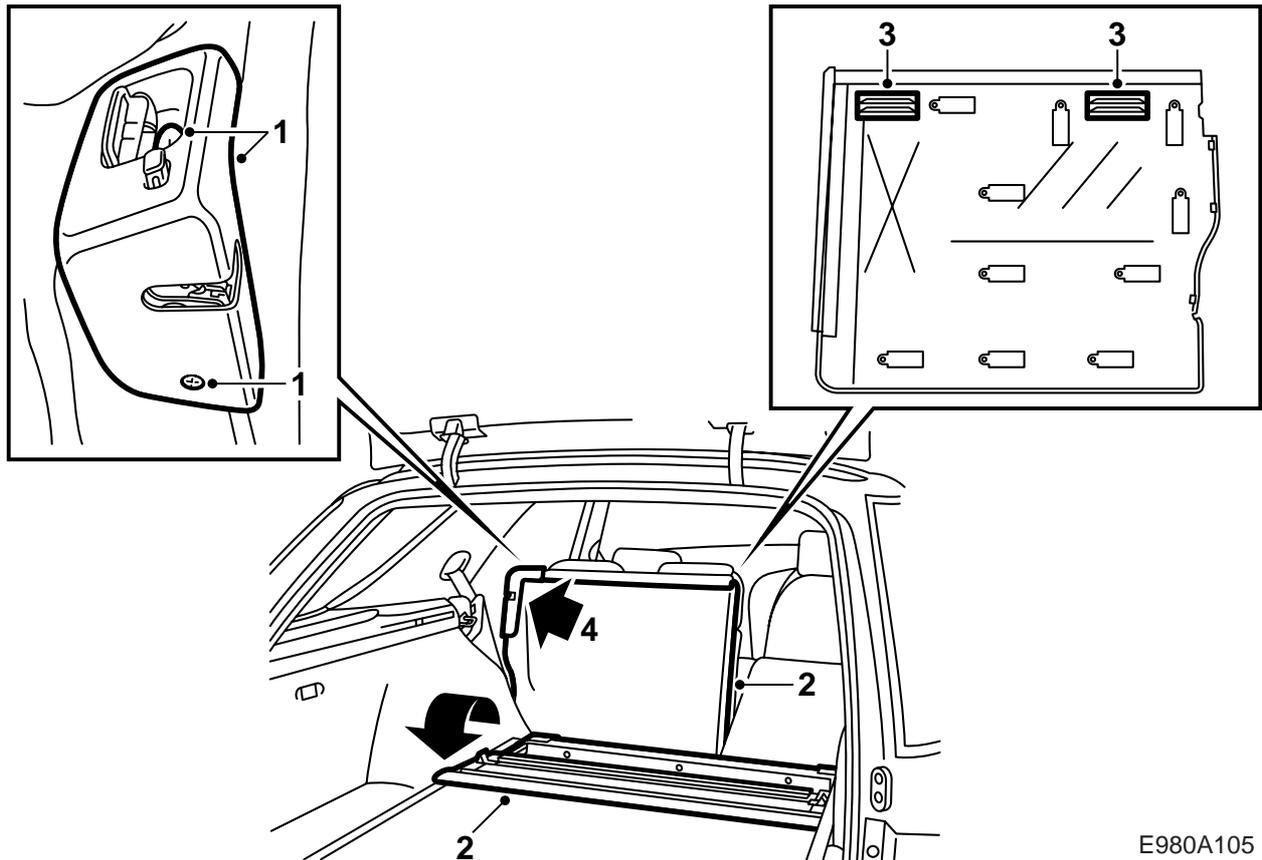




E980A105

- 1 Fold the entire backrest forwards. Remove the plastic cover over the hinge fitting on the left-hand section (the 60% section).
- 2 Lift up the front part of the luggage compartment floor and remove the trim from the back of the left-hand backrest.
- 3 Make two rectangular holes as marked on the reverse side of the trim.
- 4 Refit the trim on the backrest, making sure that the trim fastens securely in the clips.

### Note

If necessary, tap the upper part of the backrest against the trim if there is a gap between backrest and trim. Compare it with the smaller backrest section.

Refit the cover over the hinge fittings and fit the luggage compartment floor back in place.

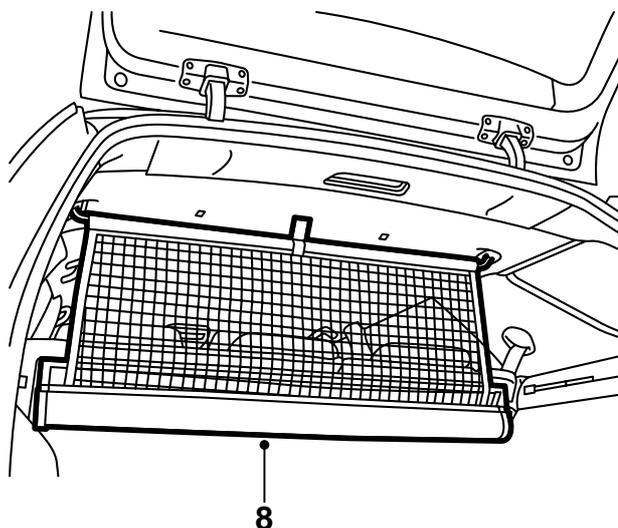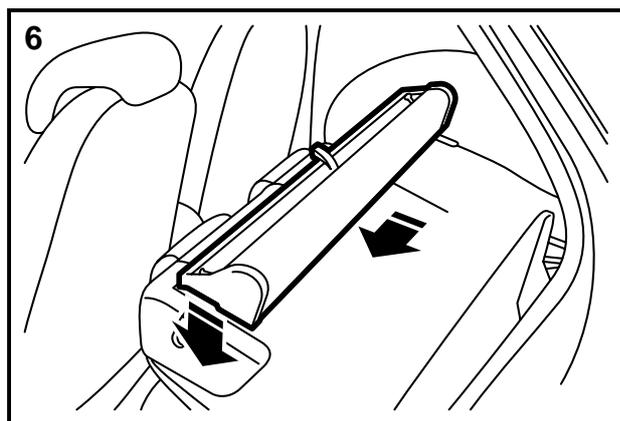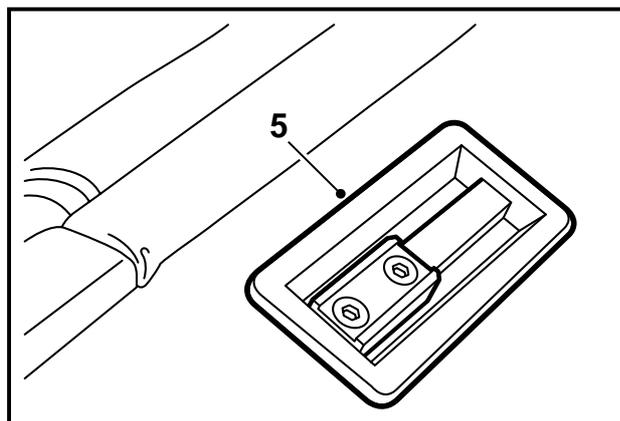

E980A106

- 5 Fit the rectangular plastic fittings in the trim with their screw holes to the left. Screw the plastic fittings and the slide rails to the backrest (2 x 2 screws, the chamfered edges of the slide rails should be on the right).
- 6 Position the cargo net with its cassette so that the rails enter the plastic fitting and make secure by sliding the entire cassette to the left.
- 7 Raise the left-hand backrest section (60% section) first and then the right-hand section.  
Carefully remove the cover washers in the roof attachments, using a small screwdriver.
- 8 Pull the net diagonally rearwards out of the cassette. Fit the hooks in the roof attachments, one side at a time, and then release the net. It will then fasten in the cassette's rearward-facing hooks.

**⚠ WARNING**

Take care when lowering the 60% section of the backrest when the 40% section is already lowered. The net's cassette could cause injury if anyone is in the vicinity of the 40% section.